

INSPECTION REPORT



For the Property at:

[Redacted address line 1]


[Redacted address line 2]

[Redacted address line 3]

[Redacted address line 4]

[Redacted address line 5]

Prepared by: Robert Byrne, License# 16000062890

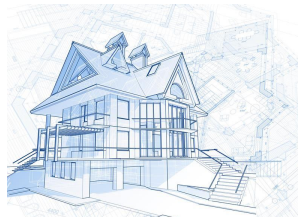

Higher Elevation Home & Commercial Inspections LLC
188 Brown Street
Sea Cliff, NY 11579
(516) 509- 9091



[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

Thank you for choosing HIGHER ELEVATION LLC to perform your home inspection. The inspection itself and the attached report comply with the requirements of the Standards of Practice of our national Association. This document defines the scope of a home inspection.

Clients sometimes assume that a home inspection will include many things that are beyond the scope. We encourage you to read the Standards of Practice so that you clearly understand what things are included in the home inspection and report.

The report has been prepared for the exclusive use of our client. No use by third parties is intended. We will not be responsible to any parties for the contents of the report, other than the party named herein .

The report is effectively a snapshot of the house, recording the conditions on a given date and time. Home inspectors cannot predict future behavior, and as such, we cannot be responsible for things that occur after the inspection. If conditions change, we are available to revisit the property and update our report.

The report itself is copyrighted, and may not be used in whole or in part without our express written permission.

Again, thank you so very much for choosing HIGHER ELEVATION LLC to perform your home inspection.
REFERRALS AND "REVIEWS" GREATLY APPRECIATED - WWW.HIGHERELEVATIONLLC.COM

Sincerely,

Robert Byrne
on behalf of
Higher Elevation Home & Commercial Inspections LLC

Higher Elevation Home & Commercial
Inspections LLC
188 Brown Street
Sea Cliff, NY 11579
(516) 509- 9091

Higher Elevation LLC would like to thank you for choosing us to inspect your future home. Please note that every house needs annual maintenance. It is recommended the home owner budget for repair and maintenance of heating / cooling systems, plumbing, electric and site drainage (roof and gutters). The BLUE HYPER LINKS in your report will help with information about your home. Please note any recommended repairs should be done by a licensed and insured professional. Included on the last page of the report is a REFERENCE LIBRARY - PDF to help you understand your new house.

All the best

Rob Byrne - Owner / Operator

[Priority Maintenance Items](#)

Roofing

RECOMMENDATIONS \ Overview

Condition: • Licensed Roofing Contractor

Recommend licensed roofing contractor provide estimate for repairs needed to roof

FLAT ROOFING \ Roll roofing

Condition: • [Blisters](#)

Recommend licensed roofing contractor provide estimate for repair or replacement of flat roof prior to contract signing

Implication(s): Chance of water damage to structure, finishes and contents

Exterior

EXTERIOR WINDOWS \ Trim

Condition: • [Flashing loose, missing or deteriorated](#)

Recommend licensed contractor check for hidden moisture damage behind stucco and around windows. Multiple areas of stucco are cracked and deteriorated potential for hidden moisture damage.

Implication(s): Chance of water damage to structure, finishes and contents

PORCHES, DECKS, STAIRS, PATIOS \ *Stairs and landings*

Condition: • [Masonry or concrete cracking](#)

Recommend getting an estimate from a mason to properly repair front and rear steps to basement

Implication(s): Weakened structure

Structure

FOUNDATIONS \ General notes

Condition: • [Bowed, bulging or leaning](#)

Recommend licensed contractor and / or structural engineer to further evaluate and provide estimate for repair as needed.

Implication(s): Weakened structure | Chance of structural movement

FOUNDATIONS \ Beams (Girders)

Condition: • Termite damage

Excessive termite damaged to floor joists, sub flooring, sill plates and main support beam. Recommend consulting with a

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

structural engineer for proper repairs prior to contract signing.

Implication(s): Weakened structure | Chance of structural movement

FLOORS \ Sills

Condition: • Termite damage

Termite damage to sill plates and rim joists in basement. Recommend further evaluation by a licensed contractor to determine if any hidden damaged exists. Get estimate for repair prior to purchase.

Implication(s): Weakened structure

FLOORS \ Joists

Condition: • [Split or damaged](#)

Implication(s): Weakened structure | Chance of structural movement

ROOF FRAMING \ Sheathing (roof/attic)

Condition: • SOFT SPOT

Recommend roofing contractor further evaluate and advise best course of action

Location: Various

Electrical

RECOMMENDATIONS \ Overview

Condition: • Licensed electrician

****RECOMMEND LICENSED ELECTRICIAN FURTHER EVALUATE AND CORRECT ALL WIRING AND SAFETY CONCERNS PRIOR TO PURCHASE****.

MAIN PANEL \ Breaker / wire

Condition: • Missing main disconnect

MAIN PANEL \ Distribution panel

Condition: • Federal Pacific service panels can fail to trip in response to over current leading to electrical fires. Federal Pacific company no longer in business. Recommend licensed electrician replace panel.

DISTRIBUTION \ Outlets

Condition: • [No GFCI/GFI \(Ground Fault Circuit Interrupter\)](#)

Recommend licensed electrician repairing all electrical concerns. Estimate prior to contract signing

Implication(s): Electric shock

Heating

RECOMMENDATIONS \ **Buried oil tank**

Condition: • An underground oil storage tank exists on property. Request proper paperwork from seller to determine if tank was abandoned properly. Buried oil tanks are an environmental risk. Oil tank abandonment /removal costs vary depending on the extent of work required. An oil tank specialists should be consulted to evaluate and estimated cost prior to contract signing.

Recommend asking seller for proper abandonment paperwork prior to closing. Consult with your attorney.

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

Condition: • Oil tank abandoned according to home owner. Have attorney request proper documentation prior to closing
****RECOMMEND ATTORNEY REQUEST PROPER ABANDONMENT PAPERWORK PRIOR TOM CONTRACT SIGNING****

GAS HOT WATER \ *Venting system*

Condition: • [Poor connections](#)

Implication(s): Hazardous combustion products entering home

Plumbing

WASTE PLUMBING \ Traps - performance

Condition: • Old galvanized pipes rust from inside out. Budget for replacement during renovations

Budget for replacement of old galvanized plumbing in the near future. Recommend getting an estimate for replacement by a licensed plumber prior to purchase.

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document. This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

[Home Improvement - ballpark costs](#)

Observation and Recommendations

RECOMMENDATIONS \ Overview

1. Condition: • Licensed Roofing Contractor

Recommend licensed roofing contractor provide estimate for repairs needed to roof



Licensed Roofing Contractor



Licensed Roofing Contractor

2. Condition: • Leaks in roof may not appear at time of inspection and sometimes develop due to severe weather condition after inspection. We cannot predict when or if a roof might leak in the future.

FLAT ROOFING \ Roll roofing

3. Condition: • [Blisters](#)

Recommend licensed roofing contractor provide estimate for repair or replacement of flat roof prior to contract signing

Implication(s): Chance of water damage to structure, finishes and contents



Blisters



Blisters



Flat roofing material in need of repair / replacement

Blisters



areas of rolled roofing material wrinkling and blistering

Blisters

FLAT ROOF FLASHINGS \ General notes

4. Condition: • Inspect & repair as needed

Implication(s): Chance of water damage to structure, finishes and contents



Inspect and repair as needed prior to purchase

Licensed Roofing Contractor

Inspection Method and Limitations

General: • Age of roof cannot always be determined due to certain roofing materials and conditions. Leaks in roof may not appear at time of inspection and sometimes develop due to severe weather condition after inspection. We cannot predict when or if a roof might leak in the future.

Inspection performed: • By walking on roof

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	PLUMBING	INTERIOR	REFERENCE
---------	---------	----------	-----------	------------	---------	---------	----------	----------	-----------

General Info and Descriptions

Flat roofing material: • [Roll roofing](#)
Flat roof flashing material: • Metal
Approximate age: • unable to determine

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

Observation and Recommendations

RECOMMENDATIONS \ Overview

5. Condition: • Gutters and downspouts help to ensure dry basements and crawlspaces. The less water near the foundation, the lower the risk of water penetration into basement.

EXTERIOR WINDOWS \ Frames

6. Condition: • [Rust](#)

Multiple windows and framing in need of replacement

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration



Rust

EXTERIOR WINDOWS \ Trim

7. Condition: • [Flashing loose, missing or deteriorated](#)

Recommend licensed contractor check for hidden moisture damage behind stucco and around windows. Multiple areas of stucco are cracked and deteriorated potential for hidden moisture damage.

Implication(s): Chance of water damage to structure, finishes and contents

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING


INTERIOR

REFERENCE


Flashings over windows

note:

a drip cap flashing is not required if the roof overhang width is four or more times greater than the distance from the top of the window to the soffit

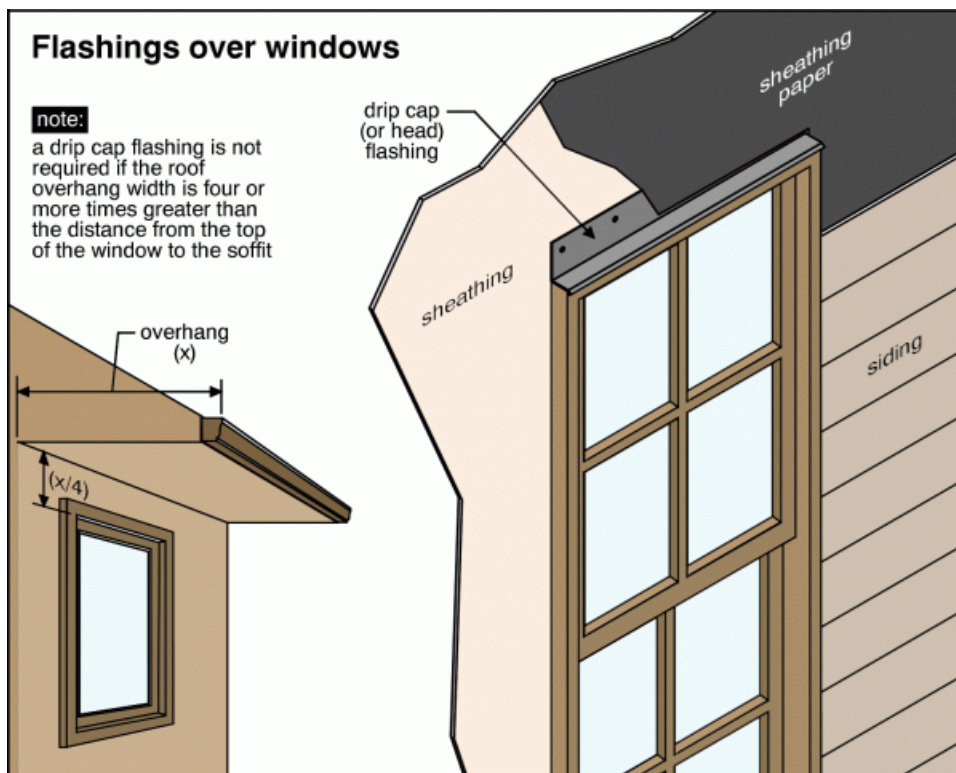

Flashing loose, missing or deteriorated

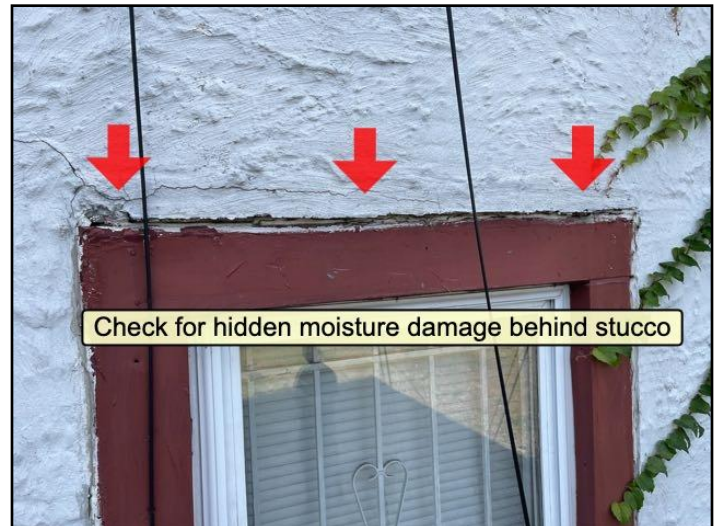

Flashing loose, missing or deteriorated

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR


REFERENCE



Excessive wood rot around multiple windows

*Flashing loose, missing or deteriorated***PORCHES, DECKS, STAIRS, PATIOS \ *Stairs and landings*****8. Condition:** • [Masonry or concrete cracking](#)

Recommend getting an estimate from a mason to properly repair front and rear steps to basement

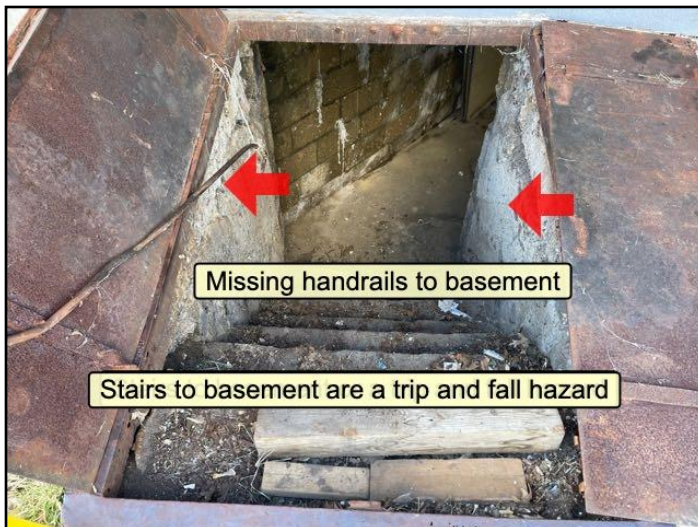Implication(s): Weakened structure

Missing handrails to basement

Stairs to basement are a trip and fall hazard

Masonry or concrete cracking

Stairs to basement damaged - dangerous - trip hazard

Masonry or concrete cracking

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Masonry or concrete cracking



Masonry or concrete cracking



Masonry or concrete cracking



Masonry or concrete cracking

LANDSCAPING \ #Walkway**9. Condition:** • [Cracked or damaged surfaces](#)**Implication(s):** Trip or fall hazard

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

*Cracked or damaged surfaces**Cracked or damaged surfaces***COMMENTS \ Additional**

10. Condition: • See Home Reference Library on last page of report for more information and understanding of your new house.

11. Condition: • Photos are only a representative sample of condition observed. There may be other areas of concern not shown by photo but stated in the report as a recommendation.

General Info and Descriptions

Gutter & downspout material: • [Aluminum](#)

Gutter & downspout type: • Close to house no soffits

Gutter & downspout discharge: • Into waste line

Lot slope: • [Away from building](#)

Wall surfaces and trim: • [Metal siding](#) • [Stucco](#)

Garage: • No garage

Observation and Recommendations

FOUNDATIONS \ General notes


12. Condition: • [Bowed, bulging or leaning](#)

Recommend licensed contractor and / or structural engineer to further evaluate and provide estimate for repair as needed.

Implication(s): Weakened structure | Chance of structural movement


Foundation movement associated with horizontal cracks

horizontal foundation cracks are often accompanied by bowing, bulging or leaning

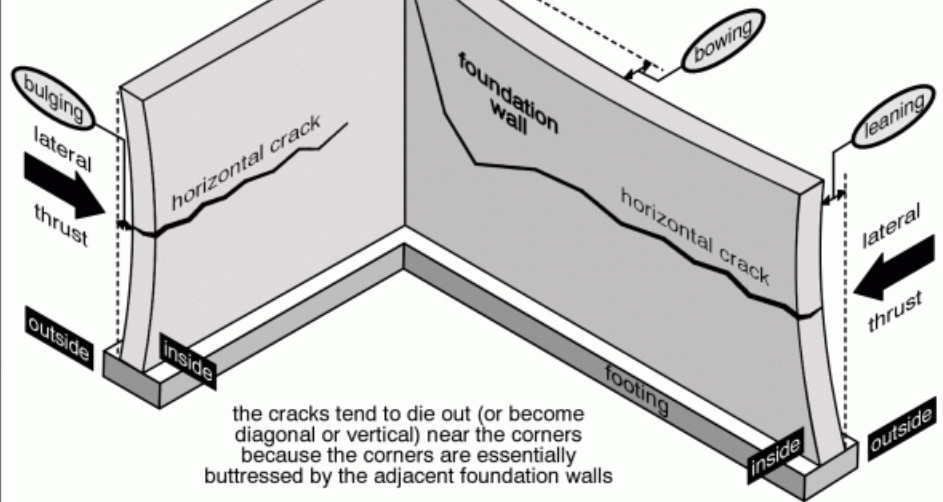

Vertical foundation cracks

short foundation wall (crawl space for example)

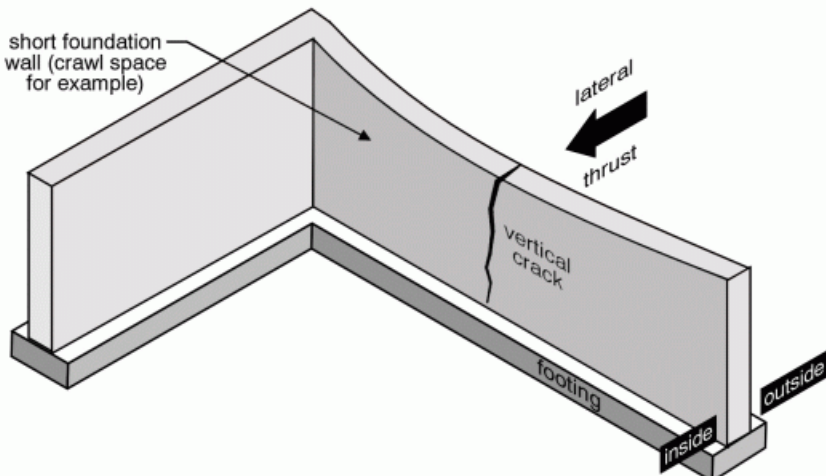

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Basement foundation cracked in various locations

Bowed, bulging or leaning



Rear wall of building damaged

Recommend further evaluation by structural engineer

Bowed, bulging or leaning



Rear wall of building has shifted



Bowed, bulging or leaning

FOUNDATIONS \ Beams (Girders)

13. Condition: • Termite damage

Excessive termite damaged to floor joists, sub flooring, sill plates and main support beam. Recommend consulting with a structural engineer for proper repairs prior to contract signing.

Implication(s): Weakened structure | Chance of structural movement

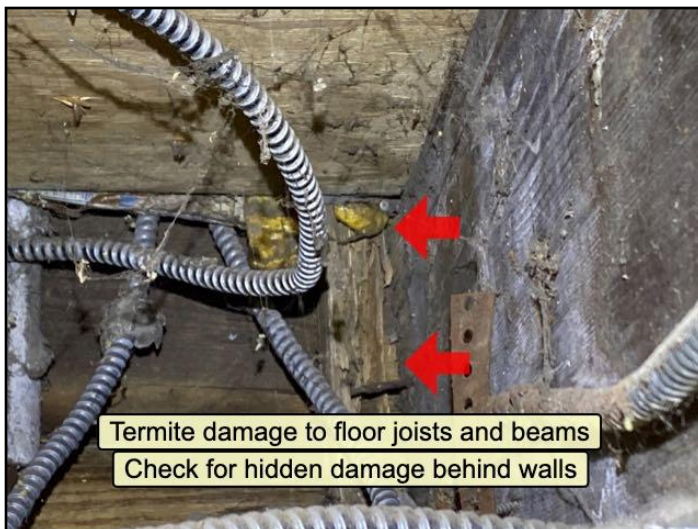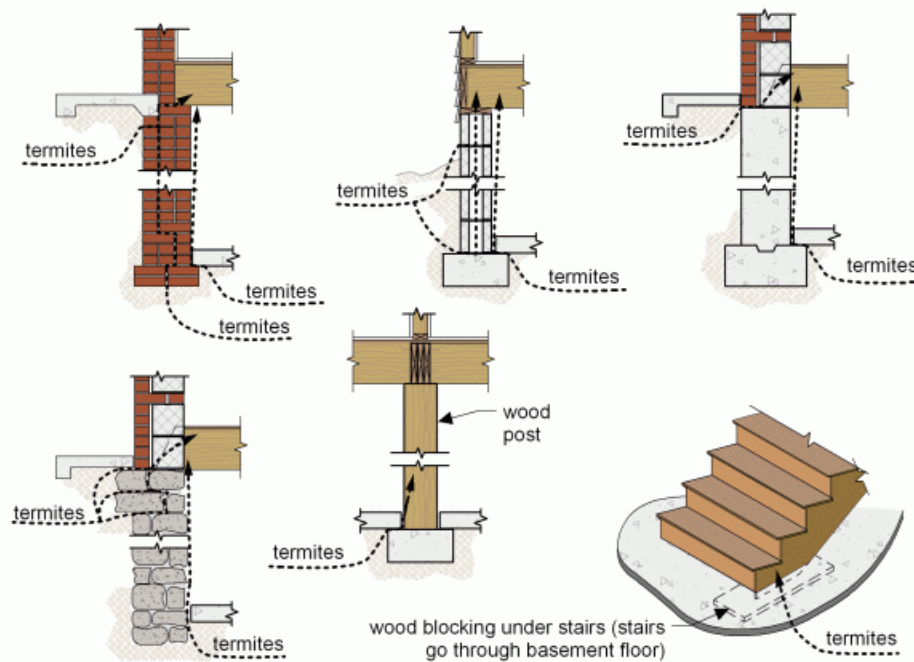Inspecting for subterranean termites - interior

Termite damage



Termite damage

14. Condition: • [Prior repairs](#)**Implication(s):** Weakened structure

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING


PLUMBING

INTERIOR

REFERENCE

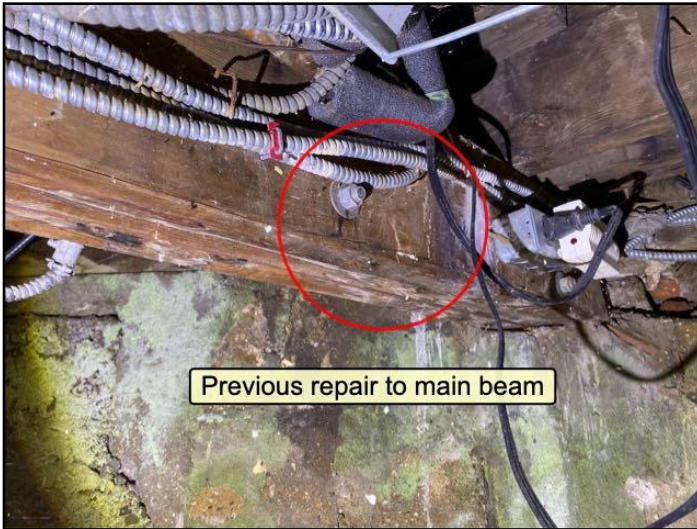

Prior repairs

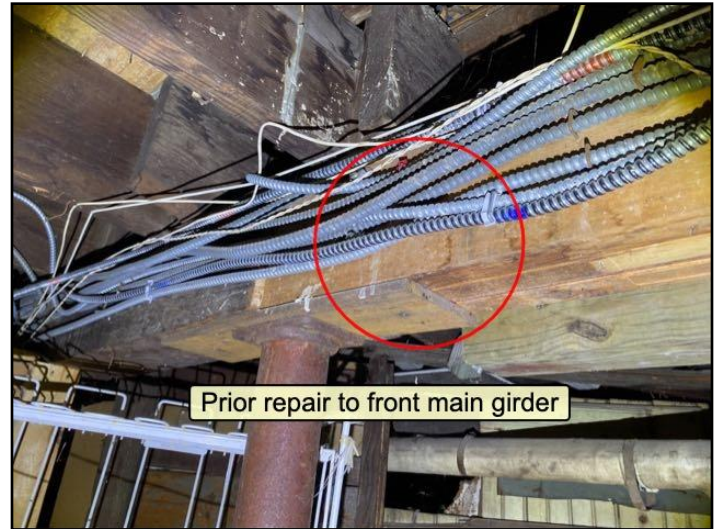

Prior repairs


FLOORS \ Sills**15. Condition:** • Termite damage

Termite damage to sill plates and rim joists in basement. Recommend further evaluation by a licensed contractor to determine if any hidden damaged exists. Get estimate for repair prior to purchase.

Implication(s): Weakened structure



Termite damage

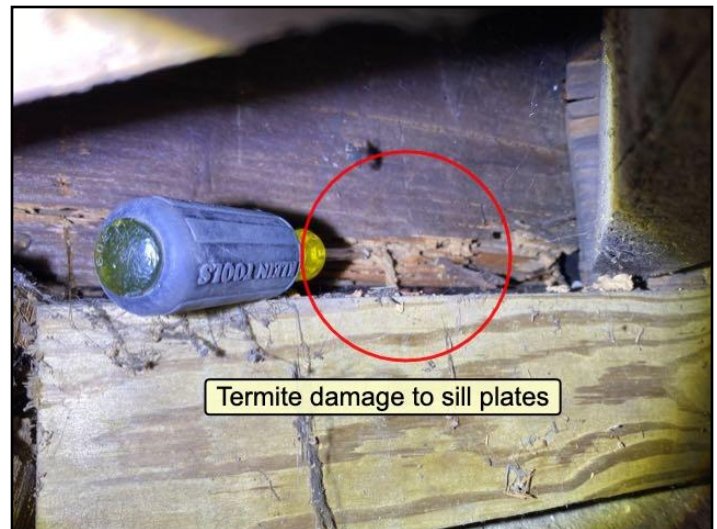

Termite damage

FLOORS \ Joists**16. Condition:** • [Split or damaged](#)

Implication(s): Weakened structure | Chance of structural movement

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

PLUMBING


INTERIOR

REFERENCE

Common causes of cracked joists

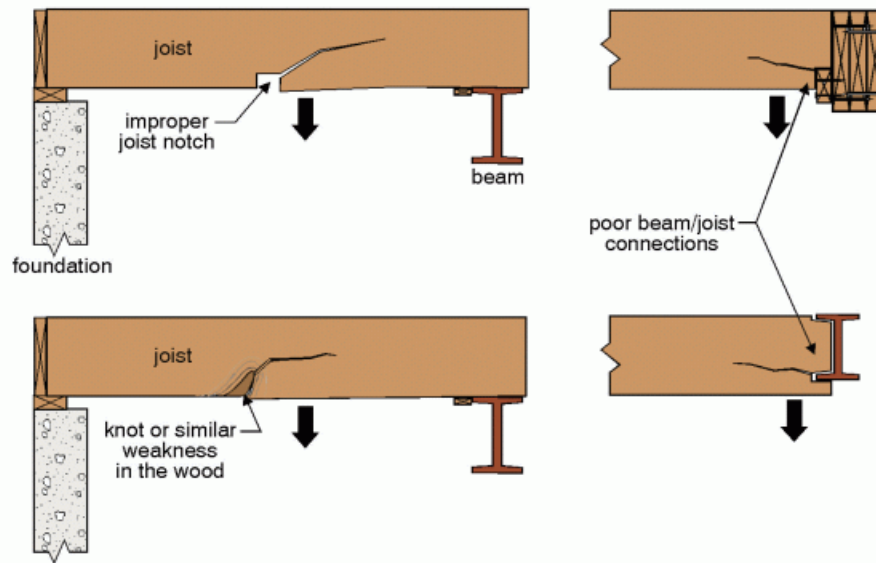

Split or damaged

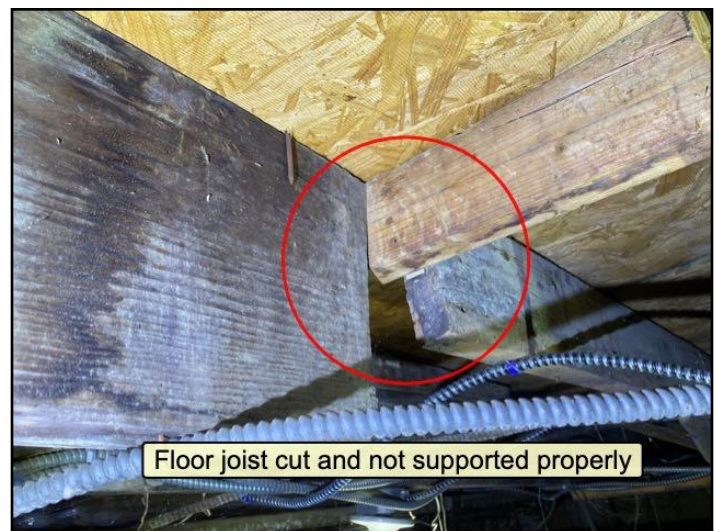

Split or damaged

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Improper repair to damaged floor joist

*Split or damaged***FLOORS \ Sheathing/Subflooring****17. Condition:** • Damaged

Sub flooring water damaged

Damaged

Subflooring in need of replacement

*Damaged***ROOF FRAMING \ Sheathing (roof/attic)****18. Condition:** • SOFT SPOT

Recommend roofing contractor further evaluate and advise best course of action

Location: Various

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

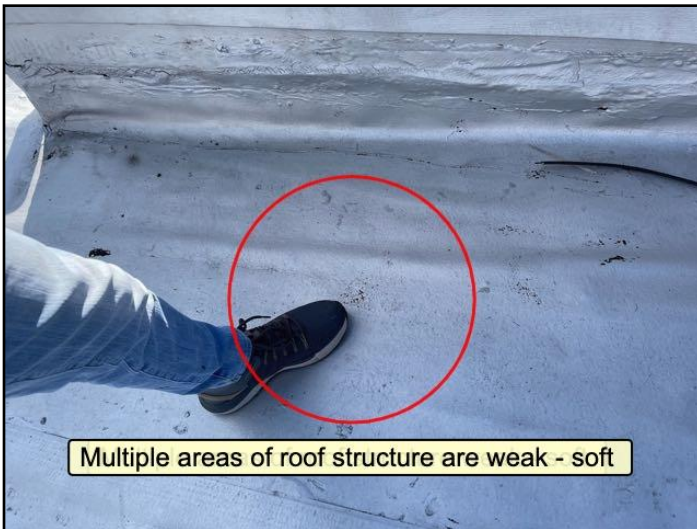

SOFT SPOT



SOFT SPOT

Inspection Method and Limitations

General: • Please note that an inspection is not a guarantee that you do not have termites or damage in visually inaccessible areas, such as inside walls or behind finished basement surfaces. Recommend an annual Termite and/or Carpenter Ant inspection.

Inspection limited/prevented by: • Finished living space unable to do a visual inspection. • Ceiling, wall and floor coverings • Carpet/furnishings

Attic space:

- No access



No access



No access

Not included as part of inspection: • Visible mold evaluation is not included in the building inspection report • An opinion about the adequacy of structural components

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	PLUMBING	INTERIOR	REFERENCE
---------	---------	----------	-----------	------------	---------	---------	----------	----------	-----------


General Info and Descriptions

- Configuration: • [Basement](#)
- Foundation material: • [Masonry block](#)
- Floor construction: • [Joists](#)
- Exterior wall construction: • [Wood frame](#)
- Roof and ceiling framing: • Not visible

Observation and Recommendations

RECOMMENDATIONS \ General

19. Condition: • Old cloth wires have tendency to dry out an loose there insulation. Recommend upgrading

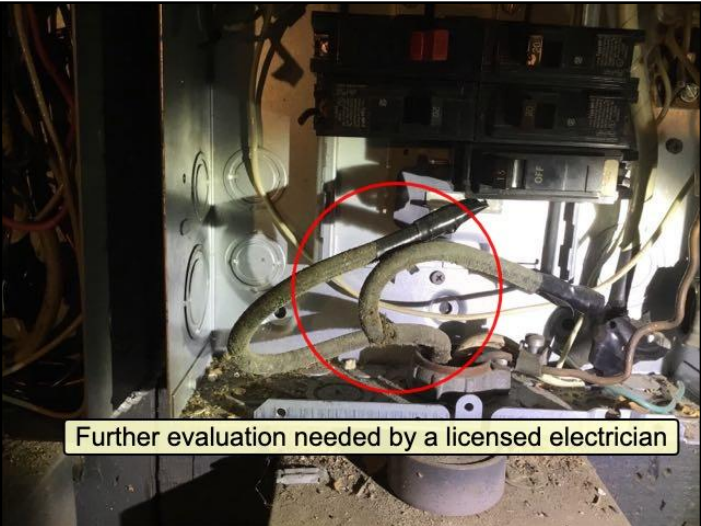

Old cloth wires have tendency to dry out an...




Old cloth wires have tendency to dry out an...

RECOMMENDATIONS \ Overview

20. Condition: • Licensed electrician

****RECOMMEND LICENSED ELECTRICIAN FURTHER EVALUATE AND CORRECT ALL WIRING AND SAFETY CONCERNS PRIOR TO PURCHASE****.

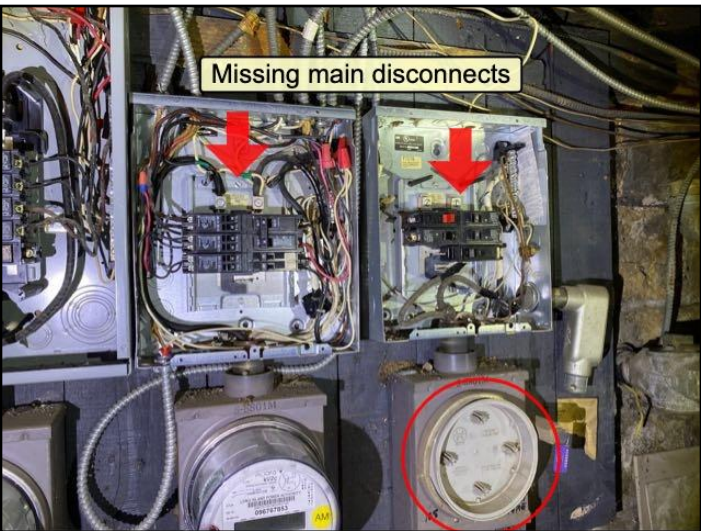

Licensed electrician

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING


PLUMBING

INTERIOR


REFERENCE



Licensed electrician

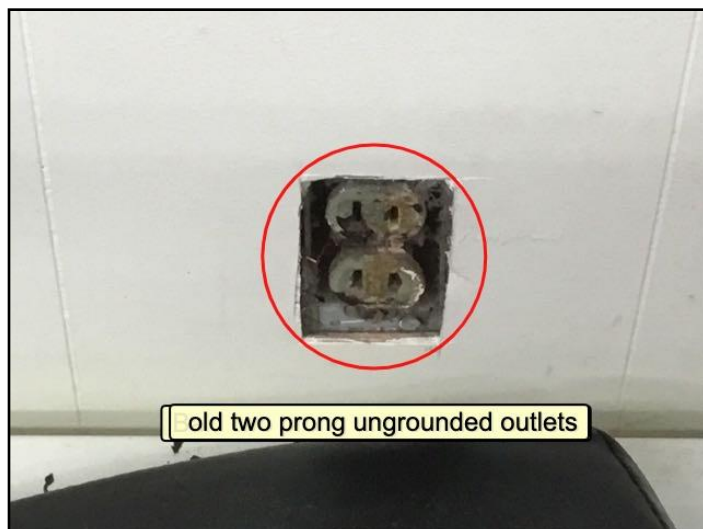

Licensed electrician

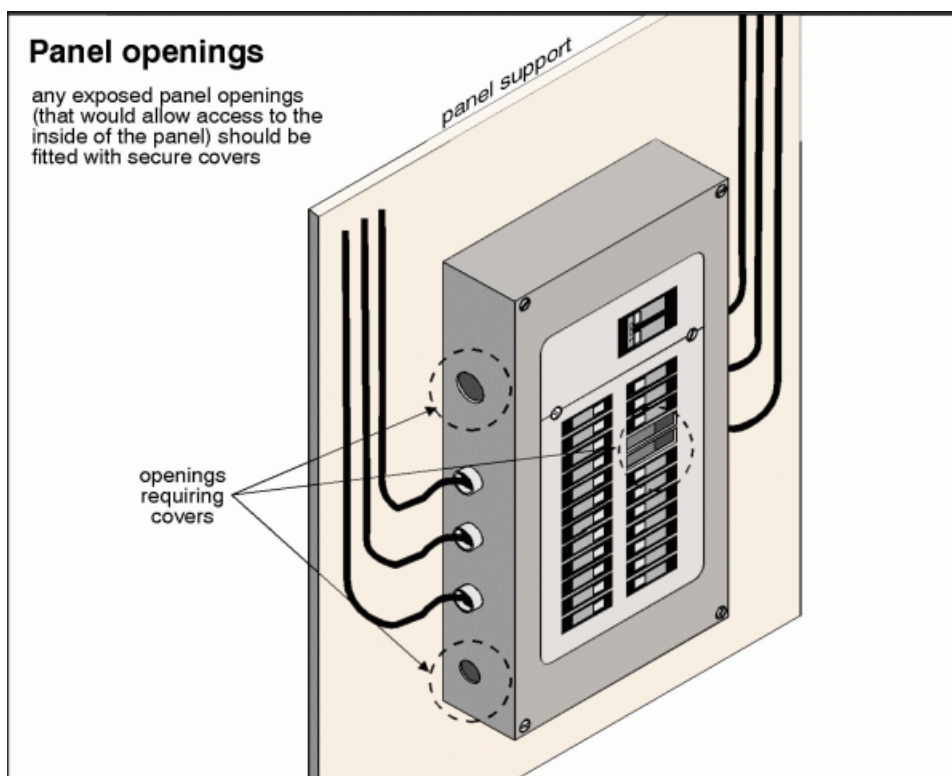MAIN PANEL \ Meter pan - Service box**21. Condition:** • [Unprotected openings](#)**Implication(s):** Electric shock

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING


PLUMBING

INTERIOR

REFERENCE



Unprotected openings

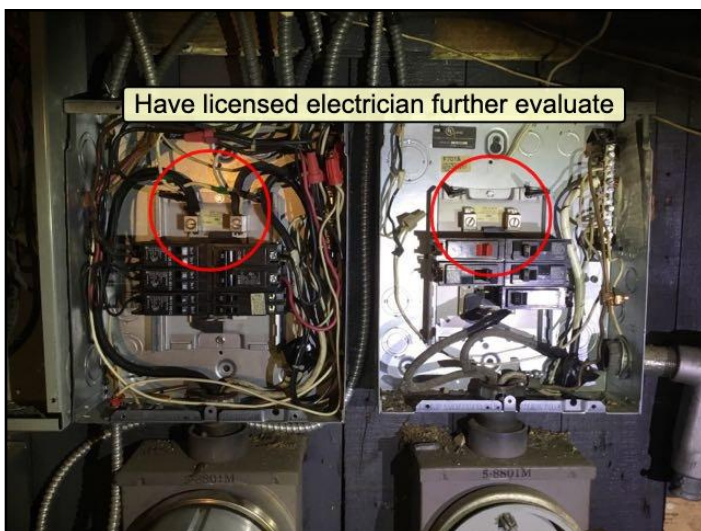MAIN PANEL \ Breaker / wire**22. Condition:** • Missing main disconnect**MAIN PANEL \ Distribution panel**

23. Condition: • Federal Pacific service panels can fail to trip in response to over current leading to electrical fires. Federal Pacific company no longer in business. Recommend licensed electrician replace panel.

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

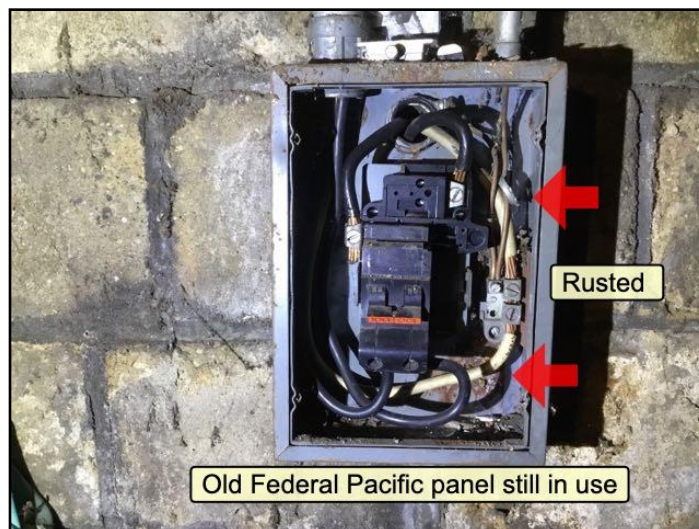

Federal Pacific service panels can fail to...

DISTRIBUTION \ Wiring (wires) - installation

24. Condition: • WIRES EXPOSED



WIRES EXPOSED



WIRES EXPOSED

DISTRIBUTION \ Outlets

25. Condition: • [Inoperative](#)

Implication(s): Equipment inoperative

Location: Basement

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

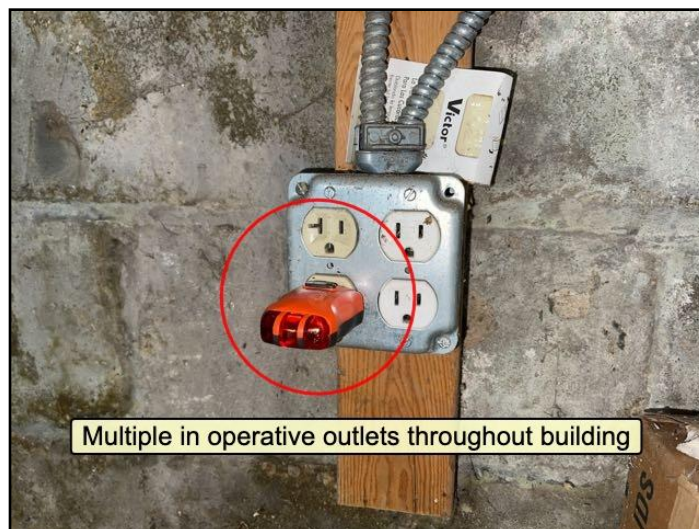


Inoperative

26. Condition: • [No GFCI/GFI \(Ground Fault Circuit Interrupter\)](#)

Recommend licensed electrician repairing all electrical concerns. Estimate prior to contract signing

Implication(s): Electric shock

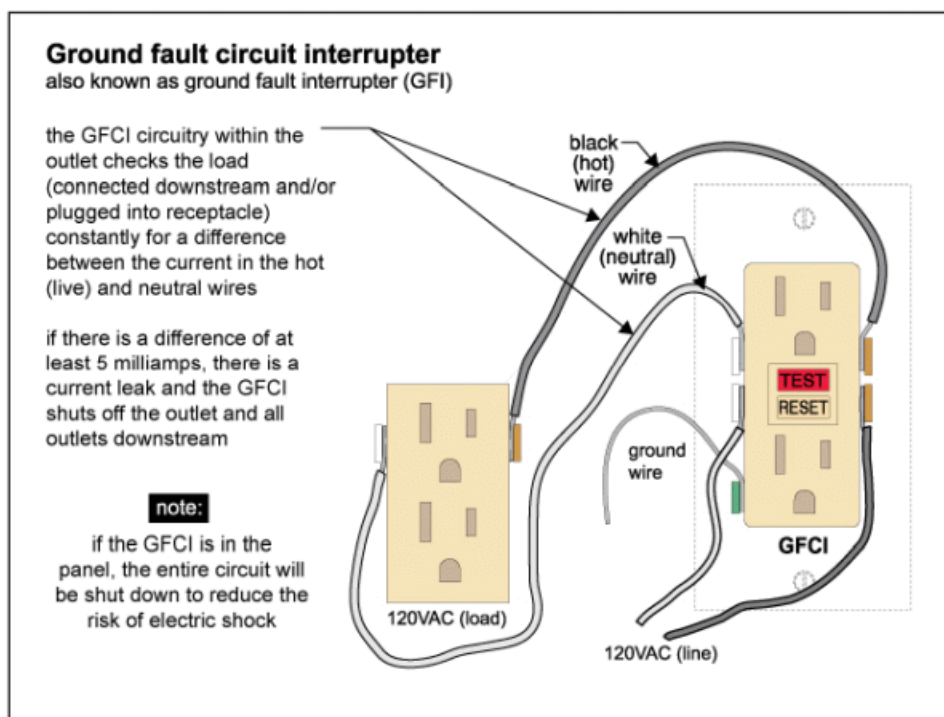

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

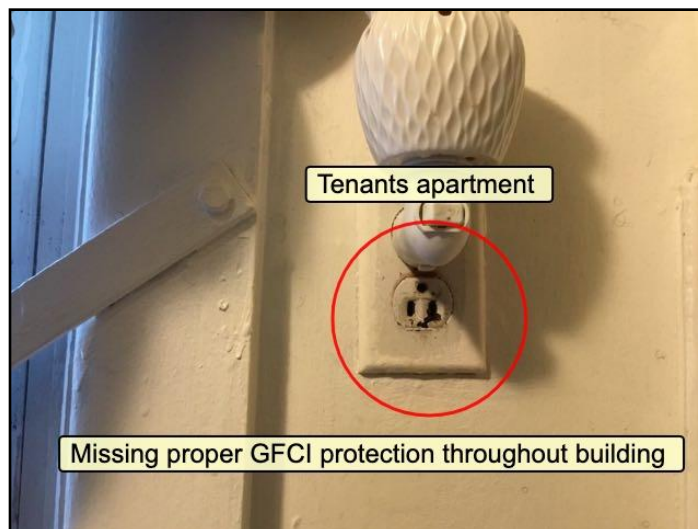

No GFCI/GFI (Ground Fault Circuit...

COMMENTS \ Additional

27. Condition: • See Home Reference Book located on last page of report for additional information and understanding of the systems in your home.

General Info and Descriptions

General:

- General view of electrical system



General view of electrical system

- More than 25% of all Smoke and Carbon Monoxide detectors do not operate properly. Recommend any Smoke and Carbon Monoxide detectors that are over 10 years old or have damaged test buttons be replaced immediately.

Service size: • [100 Amps \(240 Volts\)](#)

Main disconnect/service box rating: • 100 Amps

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING


INTERIOR

REFERENCE

Main disconnect/service box type and location:


- [Breakers - basement](#)

Deli panel not connected

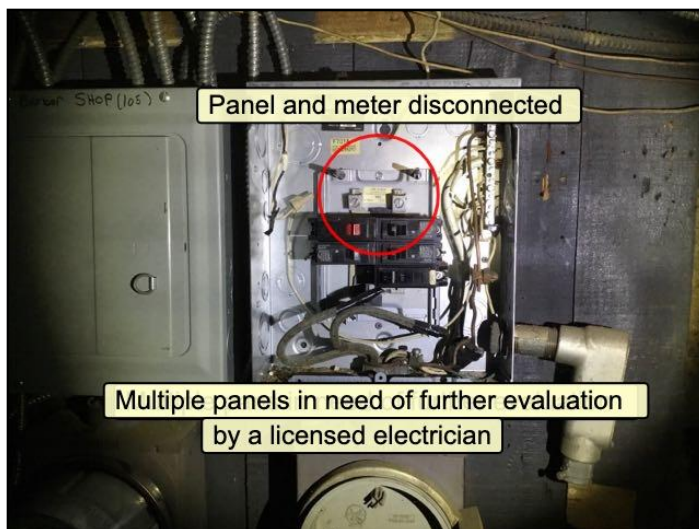*Breakers - basement*

- [Breakers - basement](#)

Barber shop

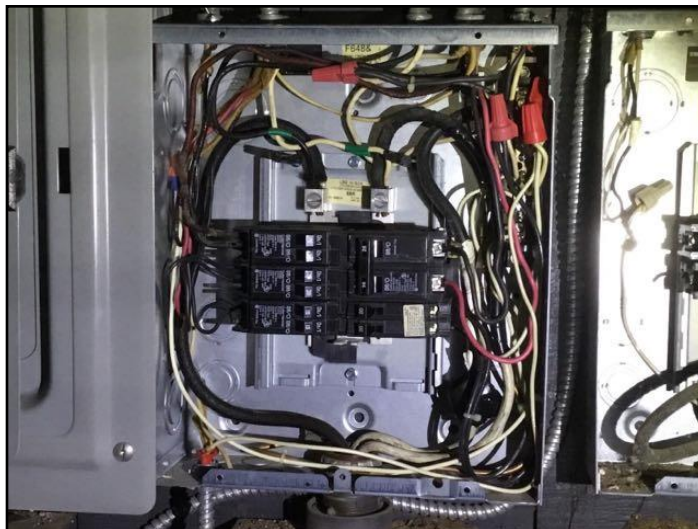*Breakers - basement*

- [Breakers - basement](#)

Beauty parlor

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING


INTERIOR

REFERENCE

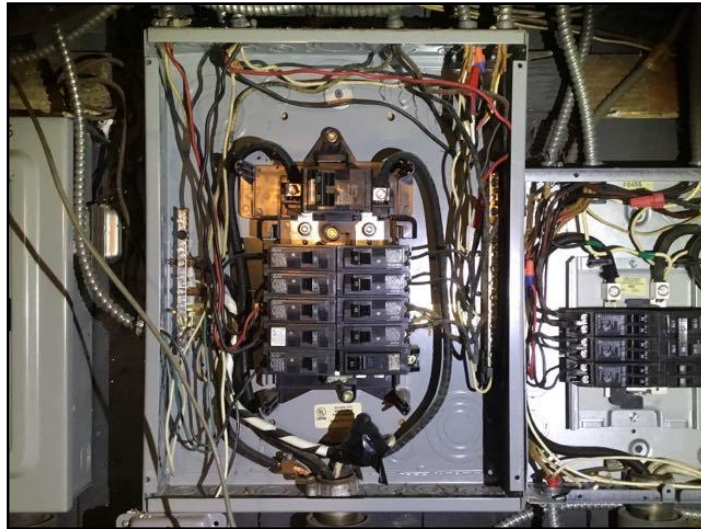

Breakers - basement

- [Breakers - basement](#)
Apartment

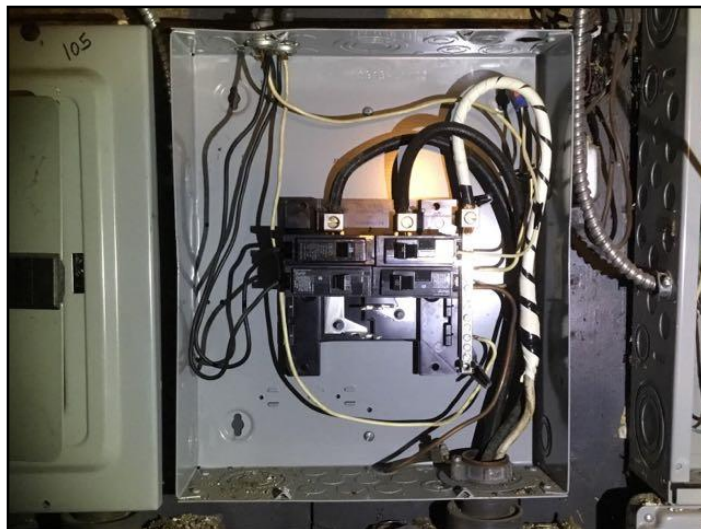

Breakers - basement

- [Breakers - basement](#)
House panel

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Breakers - basement

- [Breakers - basement](#)



Breakers - basement

- [Breakers - first floor](#)

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

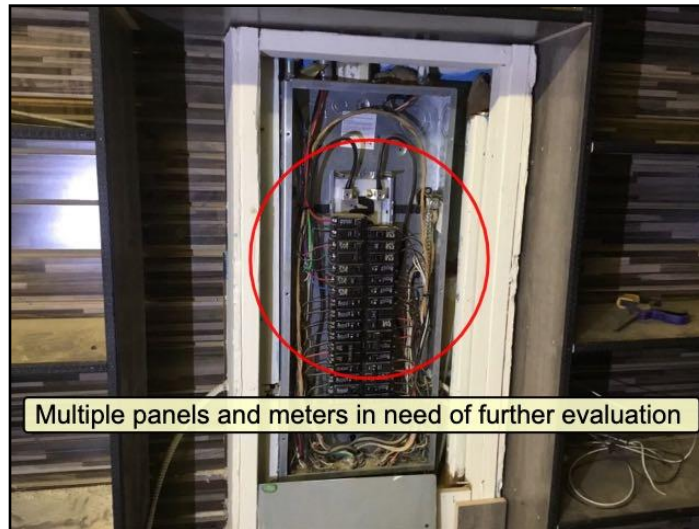

Breakers - first floor

Type and number of outlets (receptacles): • Grounded and ungrounded - typical • Ground Fault outlets (GFCI) and/or breakers are required for safety, in all interior and exterior areas, where water will be in contact with an electrical power source. Ground fault circuit interrupter (GFCI) devices should be tested periodically to ensure they remain in proper working condition.

Smoke alarms (detectors): • Recommend replacing prior to moving in

Carbon monoxide (CO) alarms (detectors): • Recommend replacing prior to moving in

Observation and Recommendations


RECOMMENDATIONS \ General

28. Condition: • Recommend an annual service contract with a licensed heating contractor.

RECOMMENDATIONS \ **Buried oil tank**

29. Condition: • An underground oil storage tank exists on property. Request proper paperwork from seller to determine if tank was abandoned properly. Buried oil tanks are an environmental risk. Oil tank abandonment /removal costs vary depending on the extent of work required. An oil tank specialists should be consulted to evaluate and estimated cost prior to contract signing.

Recommend asking seller for proper abandonment paperwork prior to closing. Consult with your attorney.

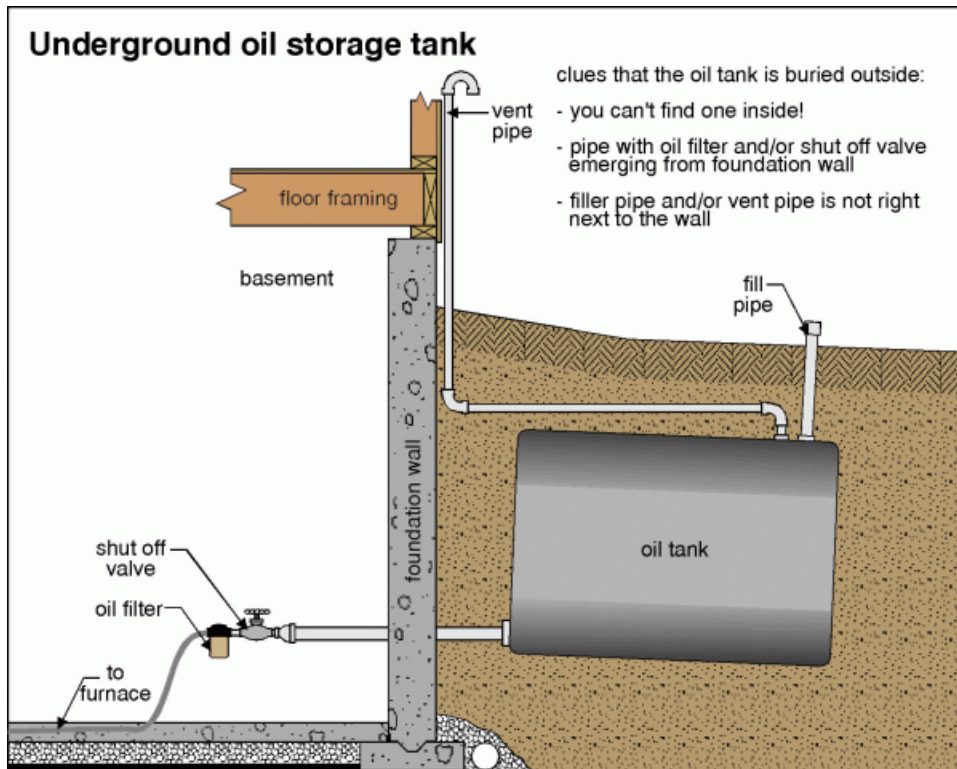

Recommend asking seller if a buried oil tan...

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

30. Condition: • Oil tank abandoned according to home owner. Have attorney request proper documentation prior to closing

****RECOMMEND ATTORNEY REQUEST PROPER ABANDONMENT PAPERWORK PRIOR TOM CONTRACT SIGNING****



Evidence of a buried oil tank


Oil tank abandoned according to home owner....

BOILER \ Heating system


31. Condition: • Rust - recommend further evaluation for all heating systems in basement budget for repair and or replacement



All heating systems need service prior to purchase

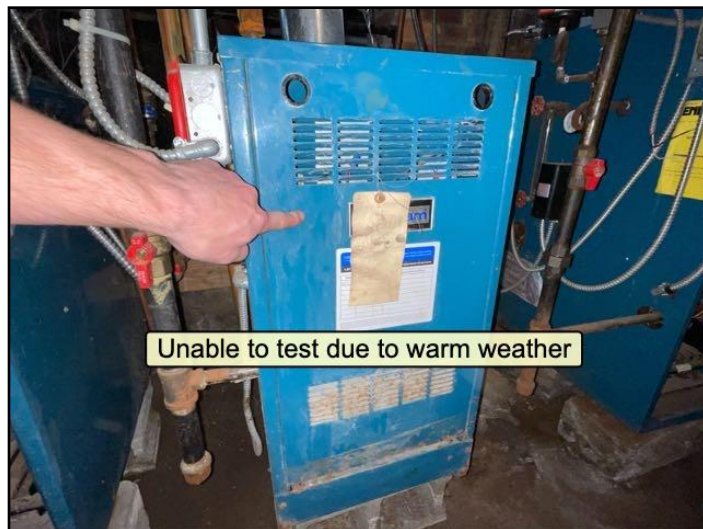


Unable to test due to warm weather

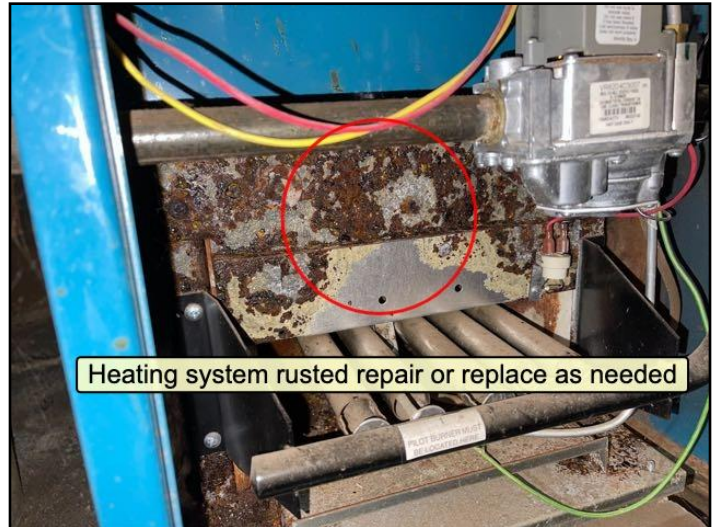

GAS HOT WATER \ *Venting system*

32. Condition: • [Poor connections](#)

Implication(s): Hazardous combustion products entering home

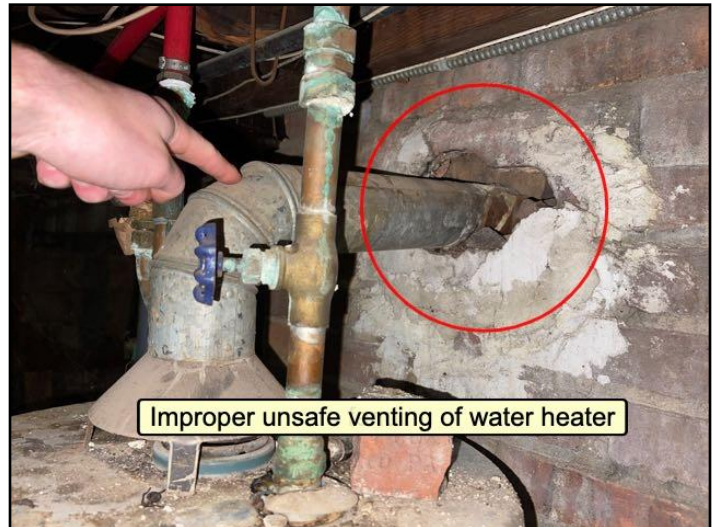

Poor connections

Poor connections

GAS STEAM \ Distribution pipes and radiators

33. Condition: • Old steam pipes may have been insulated with asbestos containing material. Ask home owner for disclosure of insulation removal. Heating pipes behind plaster walls may still have asbestos containing materials. Further evaluation by a Environmental specialists is recommended.

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Spare photos



Old steam pipes may have been insulated wit...

CHIMNEY \ Masonry chimney**34. Condition:** • Missing chimney cap

Missing chimney cap

Inspection Method and Limitations**General:** • Older houses with a masonry chimney need to be visually inspected by a professional chimney sweep to further evaluated condition of chimney prior to closing.**Inspection prevented/limited by:** • Vent connectors, chimney interiors and flues are not inspected**Warm weather:** • Prevents testing heating effectiveness • Prevented testing in heating mode**Zone, boiler and radiator valves:** • Not tested as part of a building inspection

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

General Info and Descriptions


Heating system type: • [Boiler](#)Fuel/energy source: • [Gas](#) • [Gas](#)

Boiler manufacturer:

• Burnham



Burnham

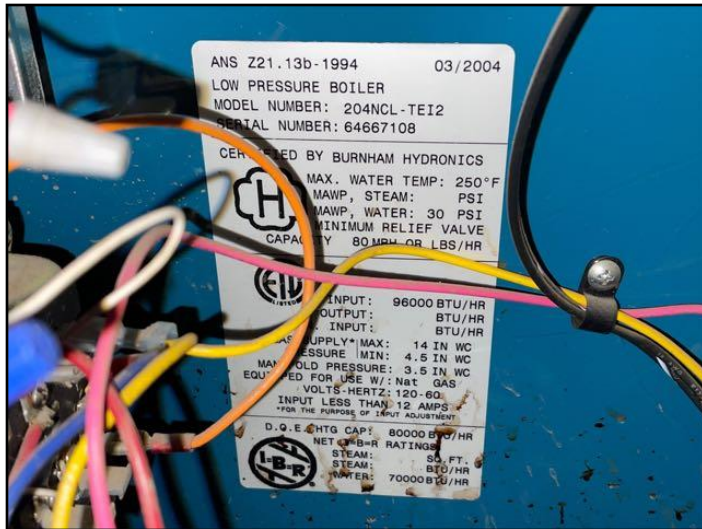

Burnham



Burnham



Burnham

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Burnham



Burnham

Oil tank type/age: • BURIED OIL TANK

Chimney/vent:

- [Masonry](#)
- [Abandoned](#)



Abandoned

Chimney liner: • [Clay](#)

General Info and Descriptions

Air conditioning type: • Air cooled

Manufacturer:

- Goodman

Rooftop air-conditioning needs to be properly supported. Consult with licensed HVAC company to properly support and secure rooftop air-conditioning.



Goodman



Goodman

Compressor type: • Electric

Compressor approximate age: • 3 years

Typical life expectancy: • 10-12 Years

Refrigerant type: • R-410A

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR


REFERENCE

Observation and Recommendations

SUPPLY PLUMBING \ Water distribution piping

35. Condition: • [Leak](#)

Implication(s): Chance of water damage to structure, finishes and contents | System inoperative

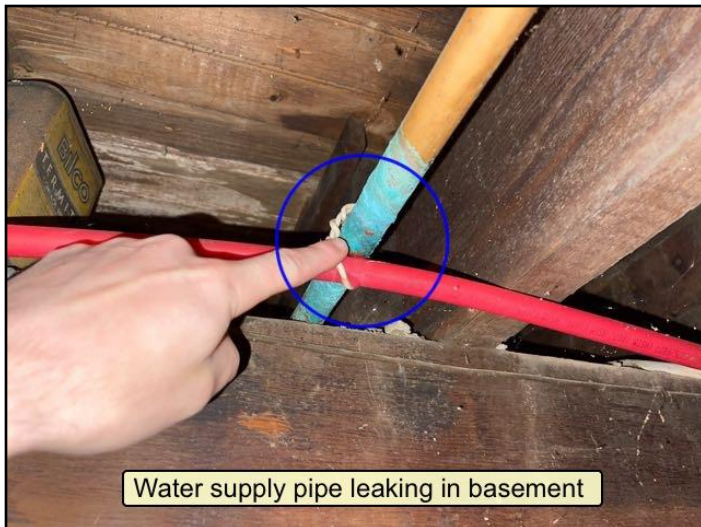

Leak



Leak

WATER HEATER \ Tank

36. Condition: • Rust

Implication(s): System inoperative | No hot water



Rust



Rust

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Rust



Rust



Rust



TPR valve leaking

Rust

WASTE PLUMBING \ Drain piping - installation

37. Condition: • [Poor slope](#)

Implication(s): Sewage entering the building

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE




Poor slope

38. Condition: • Nonstandard materials and patches

Apartment kitchen sink

Implication(s): Chance of water damage to structure, finishes and contents | Sewage entering the building

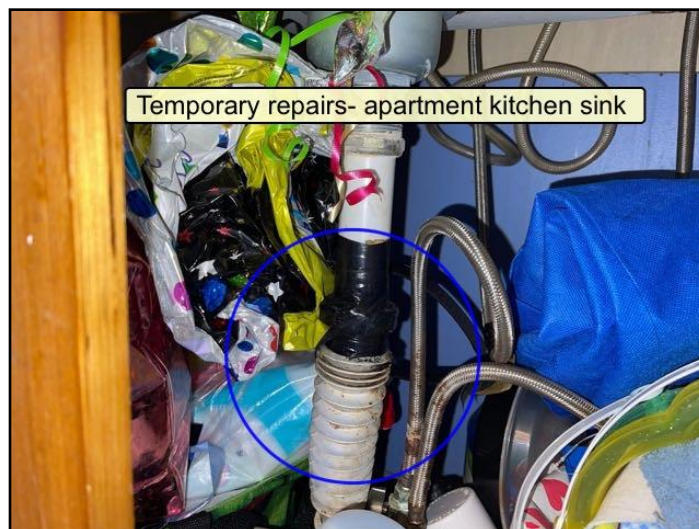

Nonstandard materials and patches

WASTE PLUMBING \ Traps - performance

39. Condition: • [Split, rusted or damaged](#)

Implication(s): Sewage entering the building



Split, rusted or damaged



Waste plumbing rusted

Split, rusted or damaged

40. Condition: • Old galvanized pipes rust from inside out. Budget for replacement during renovations
Budget for replacement of old galvanized plumbing in the near future. Recommend getting an estimate for replacement by a licensed plumber prior to purchase.



Old galvanized pipes- budget for replacement

Old galvanized pipes rust from inside out...



Old galvanized pipes rust from inside out...




Old galvanized pipes rust from inside out....

FIXTURES AND FAUCETS \ Toilet

41. Condition: • [Loose](#)

Implication(s): Chance of water damage to structure, finishes and contents | Sewage entering the building | Possible hidden damage

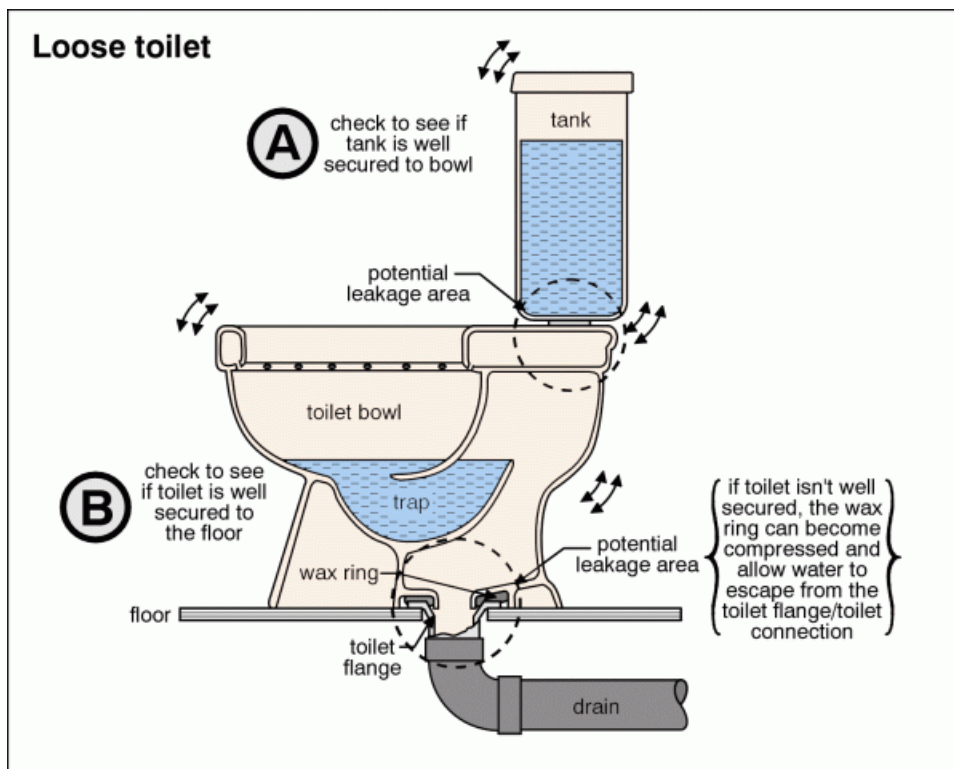

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL


HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

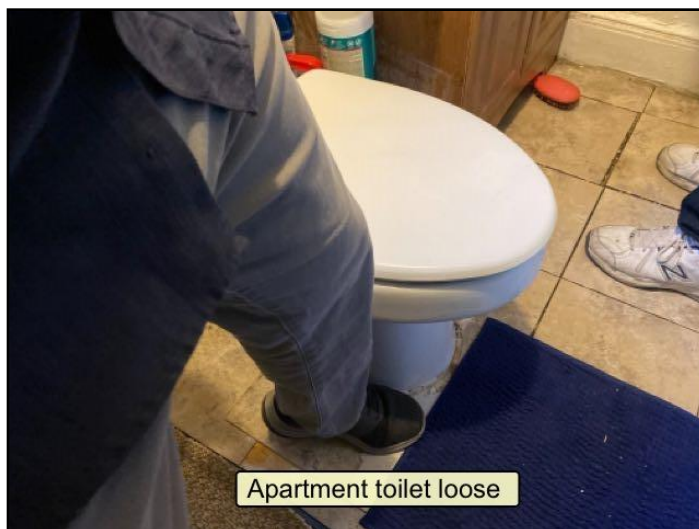*Loose*

Inspection Method and Limitations

General: • Recommend having sewer main scoped to determine condition of line prior to closing. Ask home owner when cesspool/septic system was last serviced request paperwork.

Items excluded from a building inspection: • Water quality • Isolating/relief valves & main shut-off valve • Concealed plumbing • Tub/sink overflows • Water heater relief valves are not tested • The performance of floor drains or clothes washing machine drains • Cesspools not inspected. Recommend asking current home owner for updated service maintenance contract. If unavailable have cesspool inspected prior to contract signing

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Not included as part of a building inspection: • Washing machine connections • Not readily accessible interiors of vent systems, flues, and chimneys • Landscape irrigation systems

General Info and Descriptions

Service piping into building:

- [Galvanized steel](#)

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Galvanized steel

Supply piping in building: • [Copper](#)

Main water shut off valve at the:

- Basement



Basement

Water heater fuel/energy source: • [Gas](#)


Water heater exhaust venting method: • Natural draft

Water heater manufacturer:

- Bradford White



All water heaters are near end of life expectancy
Budget for replacement

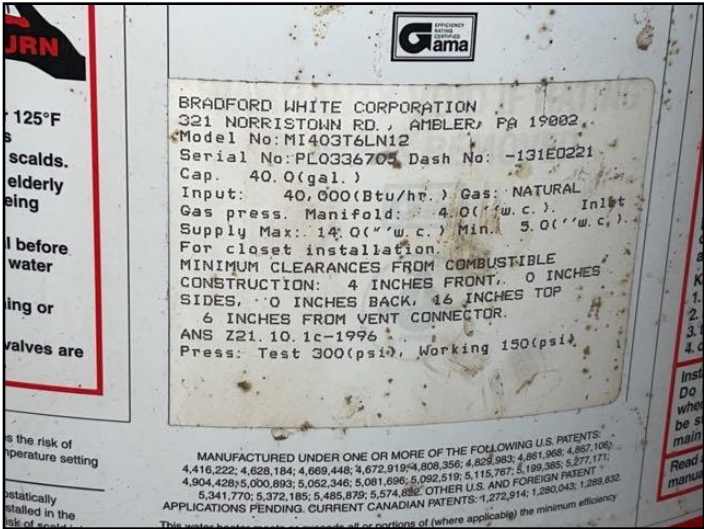

Bradford White

- Bradford White
- Rheem




Rheem

- State



State

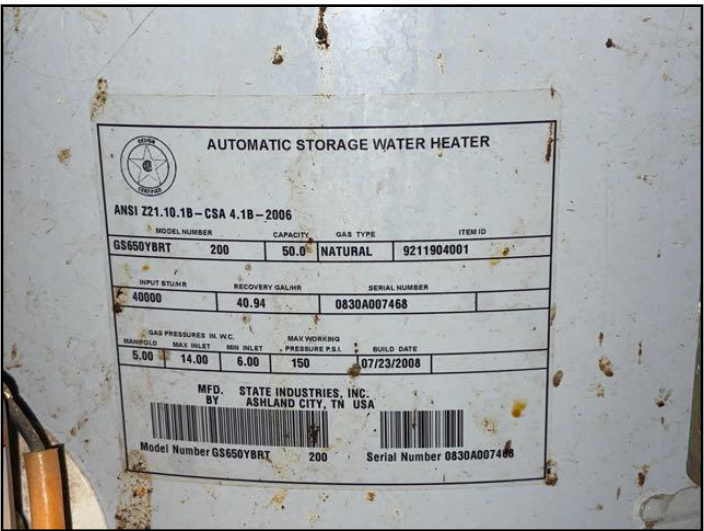

State

Water heater typical life expectancy: • 10 to 15 years


Observation and Recommendations

RECOMMENDATIONS \ General

42. Condition: • Kitchen in need of upgrading



Kitchen in need of upgrading

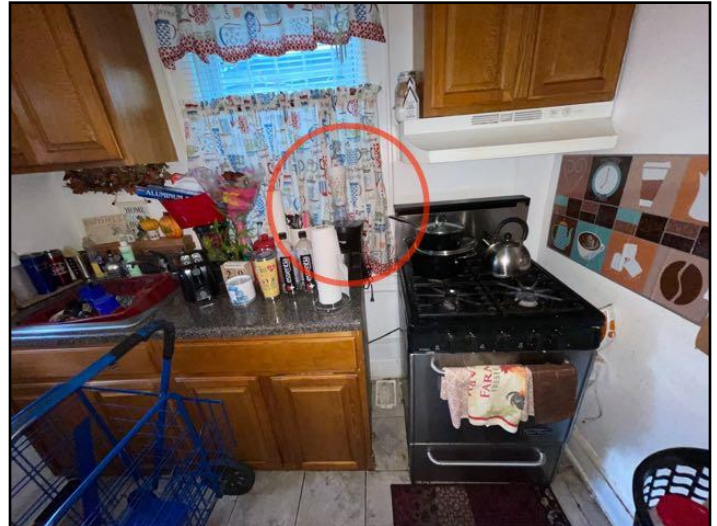


Kitchen in need of upgrading

FLOORS \ Ceramic tile, stone, marble, etc

43. Condition: • [Tiles loose](#)

Implication(s): Slip hazard

Alternatives for installing ceramic tiles

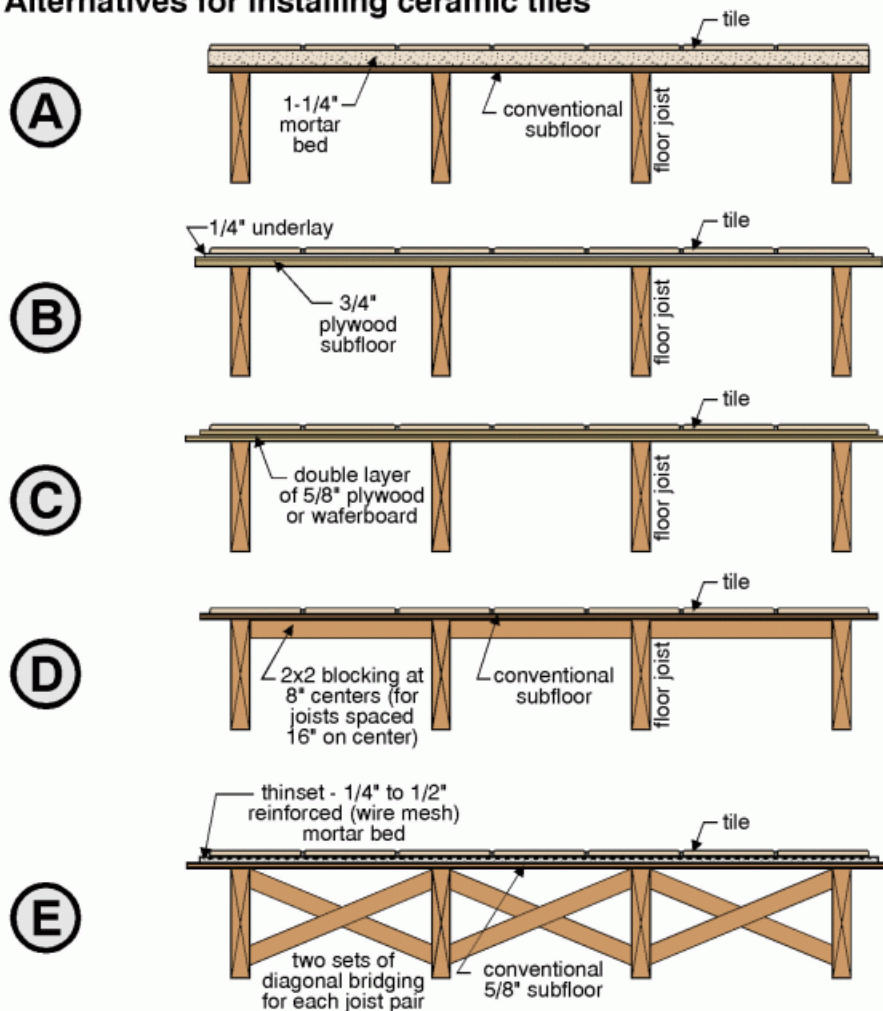

Tiles loose

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING


INTERIOR

REFERENCE

COMMENTS \ Additional


44. Condition: • Bathroom in need of upgrading. Recommend replacing old pipe/drains and upgrade electric. Insulate exterior walls.

Barber shop

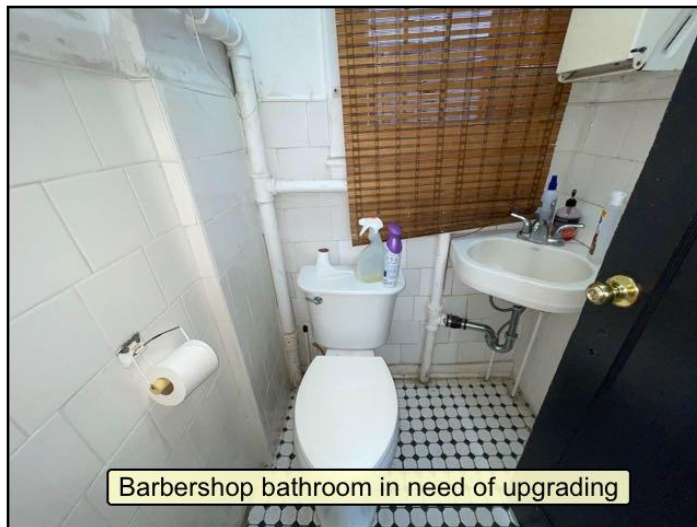

Bathroom in need of upgrading. Recommend...

45. Condition: • Bathroom in need of upgrading. Recommend replacing old pipe/drains and upgrade electric. Insulate exterior walls.

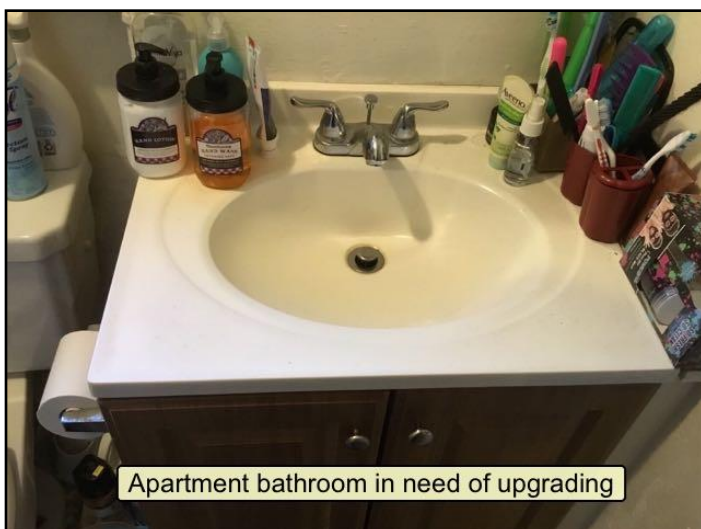

Bathroom in need of upgrading. Recommend...



Bathroom in need of upgrading. Recommend...

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Bathroom in need of upgrading. Recommend...

Inspection Method and Limitations

Inspection limited/prevented by: • Storage/furnishings

Not tested: • Oven • Microwave • Dishwasher • Central vacuum

Not included as part of a building inspection: • Carbon monoxide alarms (detectors), security systems, central vacuum • Cosmetic issues • Appliances • Perimeter drainage tile around foundation, if any • Aesthetics or quality of finishes • Underground components (e.g., oil tanks, septic fields, underground drainage systems) • Environmental issues including asbestos

Appliances: • Appliances are not inspected or moved as part of a building inspection • Appliances are not moved during an inspection

Basement leakage: • Cannot predict how often or how badly basement will leak

Environmental issues are outside the scope of a home inspection: • 1 • 1

General Info and Descriptions

Exterior doors - type/material:

- [Metal](#)

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE



Metal



Metal

END OF REPORT

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

PLUMBING

INTERIOR

REFERENCE

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS